Photograph 117
Failed wall flashing under glass block construction. Hole allows water into wall construction.

Photograph 118
Depression in retained soils behind pond retaining wall. Depression is assumed to have been caused by exfiltration through the retaining wall.

Photograph 119
Movement in retaining wall has caused the tie-back rod nut and washer to pull through the pile. Washers should have been thicker and larger in diameter.

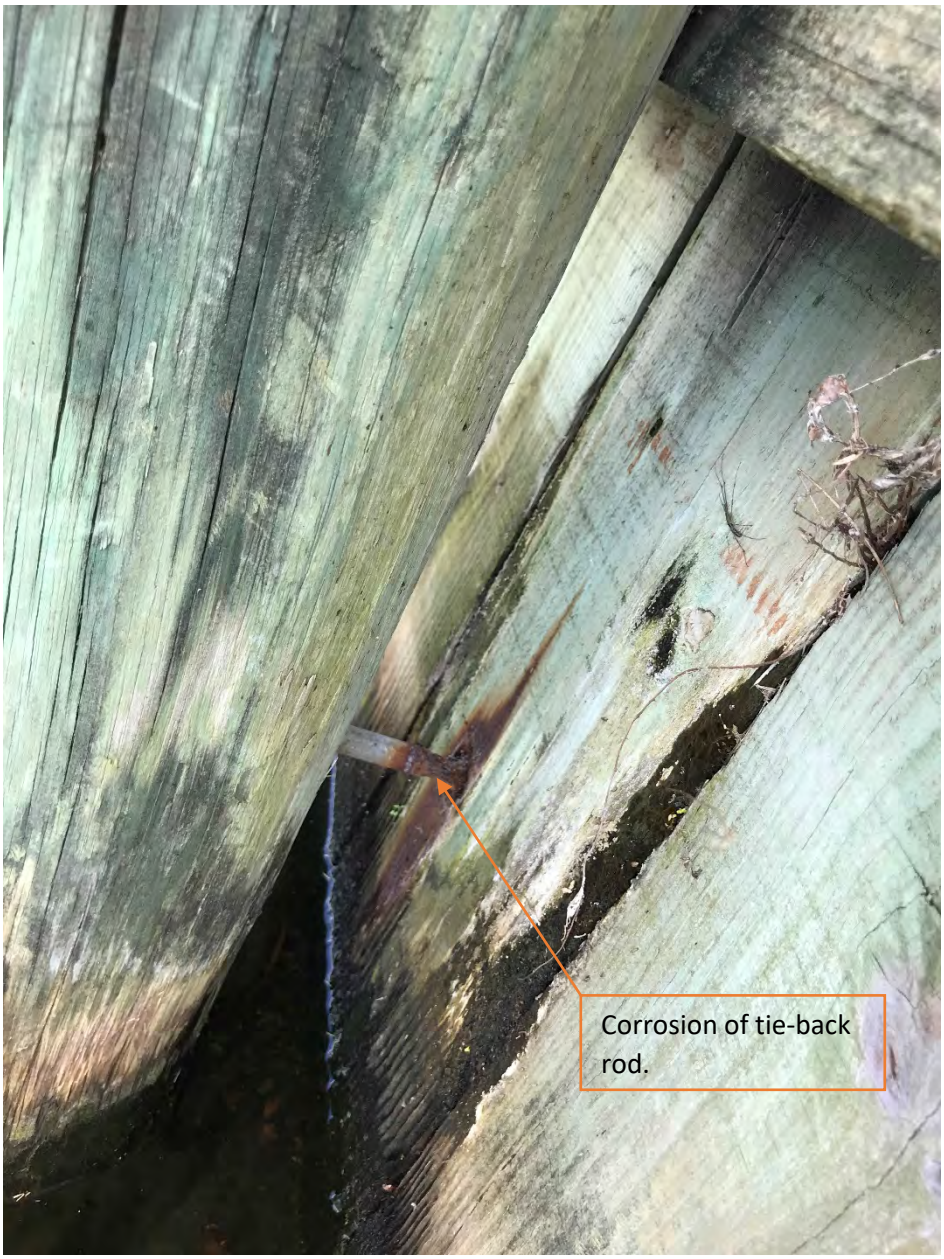

Photograph 120
Corrosion of tie back rod. Picture also indicates movement of pile, (non-corroded length of tie-back rod had previously been inside the pile).